


APPLICATION SHEET AN4300-1

Developing Voltage from 4-20mA Current Loops

The 4320, 4340, and 4370 series of transducers provide a 4 to 20mA current loop to communicate sensed values. These loops can be converted to a voltage for input to a wide variety of instrumentation devices including panel meters, data acquisition systems, and programmable controllers. By adding a precision resistor in series with the loop, a voltage is developed, which can then be inputted to the instrumentation.

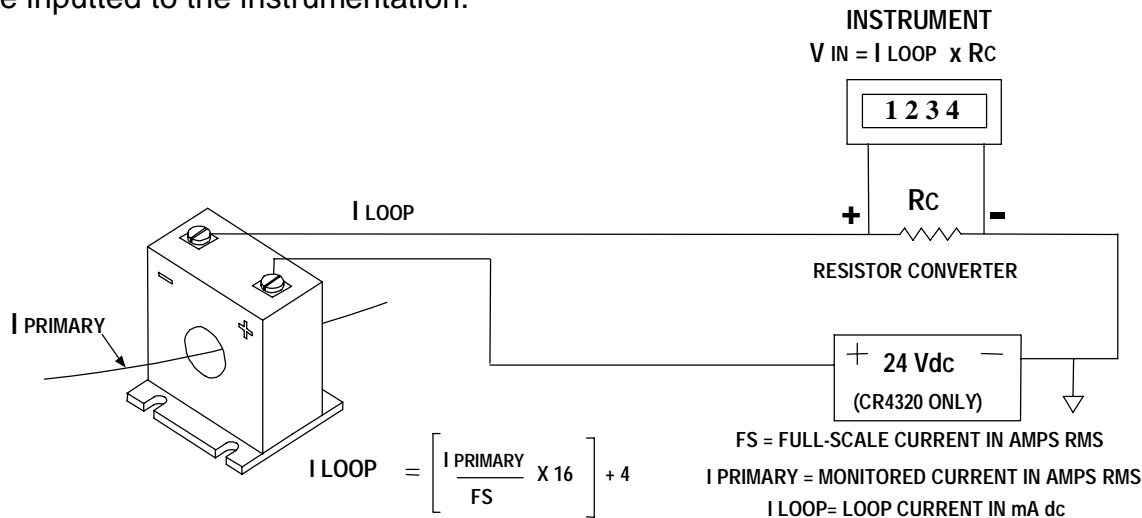

APPLICATIONS AND LIMITATIONS

- The tolerance of the resistor is critical. Tolerances of the system are additive – using a 0.5% percent transducer in conjunction with a 1% resistor results in a 1.5% tolerance system.
- The temperature coefficient of the resistor is a key factor. All electronic devices exhibit some variance with temperature. If the resistor has a large variance with temperature, the accuracy of the system will also vary with temperature.
- Self-heating of the resistor must also be considered. A typical design of 5VDC at full scale (20mA) requires a nominal resistance of 250 Ohms (5/.020). The power generated in this resistor at full scale is Volts times Amps or 5 X .020 = .100 Watts. Choosing a 1/8 Watt (.125) resistor will provide reasonable safety against destruction, but will cause a significant temperature rise in the resistor. This rise in temperature can result in significant changes in the value of the resistance. For instrumentation, a resistor with a power rating of at least 10 times the expected full scale power is recommended.
- The resistor should be mounted as close as possible to the instrumentation. Once the signal is converted from current to voltage, voltage drops from wire resistance introduces errors in the signal.
- Whenever possible, use similar materials for all wire connections. Galvanic reactions from dissimilar metals can introduce errors in the readings. An extremely low galvanic reaction such as 5mV introduces a .1% error at 5VDC full scale. Smaller reading levels results in this error being more significant.